

SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING NOVEMBER 2009

Published December 3, 2009

CHILD SEATS:

Certain Evenflo First Choice infant child restraint systems, Model 3604098, manufactured between January 16 and September 29, 2009, fail to conform to the labeling requirements of Federal Motor Vehicle Safety Standard No. 213, "Child Restraint Systems." A label containing important information was left off the seat. A label was inadvertently left off this product that contains certain required information about contacting Evenflo to register the car seat in case of a recall, information about contacting the National Highway Traffic Safety Administration for recall information, as well as a statement certifying that the car seat complies with the safety standard and is certified for use in aircraft. Evenflo will mail the required labels along with placement instructions to registered owners free of charge. The safety campaign began on November 20, 2009. Owners may contact Evenflo toll-free at 1-800-233-5921 between 8am and 5pm EST.

09C-009

EQUIPMENT:

Custom Chrome is recalling certain aftermarket Santee Bonanza motorcycle handlebars sold as replacement equipment for various Harley-Davidson motorcycles. The weld attaching the lower horizontal portion of the handlebar to the vertical portion of the handlebar can fail causing the handlebar components to separate. Separation of the handlebar components during operation could cause a crash, possibly resulting in serious injury or death. Custom Chrome will notify owners and replace the defective handlebars free of charge or offer a full refund. The safety recall began on November 13, 2009. Owners may contact Custom Chrome at 1-877-248-5840. This recall only pertains to aftermarket motorcycle handlebars and has no relation to any original equipment installed on Harley-Davidson motorcycles.

09E-058

Belkin is recalling certain aftermarket TuneBase cigarette lighter adapters sold for use in motor vehicles. The products being recalled are TuneBase FM with Hands-Free, Model No. F8Z441 / f8Z441EA, TuneBase Direct with Hands-Free, Model No. F8Z442 / F8Z442EA, and TuneBase FM with Clear Scan, Model No. F8Z176 / F8Z176EABLK. The plastic washer can cause an electrical short circuit when plugged into a vehicle's cigarette lighter adapter. If the adapter is plugged in for a long period of time, a short circuit could occur, possibly resulting in a fire. Belkin will notify owners of record and replace the adapters free of charge. The recall began on November 1, 2009. Owners may contact Belkin Traffic at 1-317-837-7308.

09E-059

Ricon is recalling certain S Series, K Series, and F9 series wheelchair lifts sold as original equipment for use on various specialty vehicles and sold through aftermarket sales. The lift is equipped with a restraint belt that has an interlock feature designed to prevent the lift from operating if the buckle is not latched. However, if the buckle is not fully latched in the affected vehicles, the lift can operate. If the buckle is not fully latched, the lift can operate and a wheelchair may not be adequately protected against movement, possibly resulting in injury to the wheelchair occupant. Each vehicle manufacturer will provide a remedy plan and notification schedule. All affected lifts will receive instructional and warning labels free of charge. Ricon will notify owners who purchased the affected lifts as aftermarket or replacement equipment. The recall is expected to begin during December 2009. Owners may contact

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2009**

Published December 3, 2009

their vehicle manufacturer or Ricon at 1-818-267-3000.

09E-060

Ricon is recall certain S Series and K Series L-model wheelchair lifts manufactured between September 2007 and October 2009, sold as original equipment for various specialty vehicles and sold through aftermarket sales. Due to a problem in the software that controls the lifts up function, if the switch is released before the floor level limit switch is activated; the lift may continue its upward travel for approximately 1 second before stopping. The continued upward travel may overrun the floor level cut off point. When the platform overruns the vehicle floor level and stops at an angle from 15-20 degrees, it is possible for a person in a wheelchair to tip over and for someone standing on the platform to fall, possibly resulting in injuries. Each vehicle manufacturer will provide a remedy plan and notification schedule. Ricon will notify owners who purchased the affected lifts as aftermarket or replacement equipment. The lifts will be repaired free of charge. The recall is expected to begin during December 2009. Owners may contact their vehicle manufacturer or Ricon at 1-818-267-3000.

09E-061

SAF-HOLLAND is recalling certain kingpins Type 64 and 65 sold for use as aftermarket equipment for tractor trailers. The subject kingpins contain defects that will allow the kingpin to crack resulting in the separation of the tractor trailer. Serious injury or death could occur should the tractor trailer separate while in operation. SAF_HOLLAND will notify owners of record and replace the defective kingpins free of charge. The safety recall is expected to begin during December 2009. Owners may contact SAF-HOLLAND toll-free at 1-888-396-6501.

09E-062

Honda is recalling aftermarket full nose masks, part number 08P35-TA0-100 and 08P35-TA6-100 manufactured between August 9, 2007 through December 11, 2007. The accessory was designed specifically for model year 2008-2010 Honda Accord 4-door vehicles. It is possible for the nose mask material to interfere with part of the hood latch. If the hood has not been completely closed and the nose mask interferes with the secondary hood latch mechanism the hood may pop open while the vehicle being driven. This may result in reduced driver visibility that could increase the risk of a crash. Honda is asking owners to please remove the nose mask immediately and call any authorized Honda dealer to make an appointment to return the nose mask and have it replaced free of charge. The safety recall is expected to begin during December 2009. Owners may contact Honda Customer Service at 1-800-999-1009.

09E-063

TIRES:

None during November 2009.

VEHICLES:

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2009

Published December 3, 2009

Jaguar is recalling certain model year 2010 vehicles. The fuel transfer pipe in the fuel tank may be kinked. This may restricts fuel being transferred from one side of the fuel tank to the fuel pump causing fuel starvation at low fuel levels. Fuel starvation to the engine can cause the engine to stall without warning and could potentially cause a crash. Dealers will have the fuel tank assembly repaired free of charge. The safety recall began on November 30, 2009. Owners may contact Jaguar at 1-800-452-4827.

09V-424

Daimler Trucks is recalling model year 2009-2010 Freightliner, and Sterling vehicles equipped Detroit Diesel DD13 EPA07 engines which were manufactured with grid heaters. Increased internal grid heater resistance caused by improperly tightened screws may melt the solder on the grid heater circuit board leading to a short circuit. A short circuit could result in a vehicle fire and injury to vehicle occupants. Detroit Diesel will repair vehicles free of charge. The engine control logic will be reprogrammed to provide cold weather starting without the need of a grid heater. Wiring to the grid heater will be removed. The safety recall is expected to begin on or before December 18, 2009. Owners may contact Detroit Diesel at 1-313-592-5800 or Daimler Trucks at 1-800-547-0712.

09V-428

Dutchmen is recalling certain travel trailers for failing to comply with the requirements of Federal Motor Vehicle Safety Standard No. Part 567, "Certification." These vehicles were manufactured with the incorrect axle information printed on the federal certification label. Towing a vehicle with the axle loaded beyond the specified weight rating may result in axle failure leading to poor vehicle handling and increasing the risk of a crash. Dutchmen will mail the corrected tag to consumers or the customer will have the option for dealers to install the label for them free of charge. The recall is expected to begin during December 2009. Owners may contact Dutchmen at 1-866-869-1109.

09V-429

Dutchmen is recalling certain travel trailers which were manufactured with incorrect axles. These vehicles were built with axles rated at 4,400 lbs. The vehicles should have been built with axles rated at 5,080 lbs. Towing a vehicle with the axle loaded beyond the specified weight rating may result in axle failure leading to poor vehicle handling and increasing the risk of a crash. Dealers will replace the axles on each vehicle with one's rated at 5,080 lbs free of charge. The recall is expected to begin during December 2009. Owners may contact Dutchmen warranty service department at 1-866-869-1109.

09V-430

Nissan is recalling certain model year 2009 passenger vehicles equipped with Bosch master cylinders. Brake fluid may leak from the master cylinder. If the amount of brake fluid in the master cylinder reservoir decreases to below the minimum level, the brake system warning indicator will illuminate as designed and the brakes will not function properly. If the warning lamp is continuously ignored, one of the brake circuits on the vehicle may fail increasing stopping distances and increasing the risk of a crash. Dealers will inspect and replace the master cylinder brake booster assembly free of charge. The recall is expected to begin during December 2009. Owners may contact Nissan at 1-800-647-7261.

09V-431

MCI is recalling certain model year 2002-2009 D series coaches, equipped with Luminator Horizon LED

SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING NOVEMBER 2009

Published December 3, 2009

side destination signs. The connector board can corrode due to an accumulation of moisture under the connector. A short could occur, possibly causing smoke and fire. MCI will notify owners and Luminator will repair the buses free of charge. Please see Luminator's defect report 09E-054. The safety recall began on November 9, 2009. Owners may contact Luminator at 1-972-516-3033 or MCI Customer Service at 1-800-241-2947.

09V-432

Spartan is recalling certain model year 2008 and 2009 fire apparatus and ambulance cab/chassis manufactured between June 2, 2008 and September 2, 2009, equipped with Cummins ISC CM2150 and ISL CM2150 model diesel engines. The vehicles may be designed with a hard wired, dash-mounted switch that enables the vehicle operator to inhibit aftertreatment diesel particulate filter regeneration in environments where the operator believes it may be unsafe for elevated exhaust temperatures. Due to an issue with the logic in the ECM software in these engines, the switch may not function correctly, leading the operator to believe that the switch is in "inhibit" mode when it is not. This condition will permit hot exhaust gases to exit the vehicle tailpipe, increasing the risk of melting or burning of nearby surfaces, or a fire. Spartan is working with Cummins to repair the engines free of charge. Please see 09E-046. The safety recall began on November 13, 2009. Owners may contact Cummins at 1-800-DIESELS (1-800-343-7357) or Spartan Chassis at 1-800-543-4277 - Option 1. Spartan's recall campaign number is 09024.

09V-433

E-N-G Mobile System is recalling certain model year 2008 Chevrolet W5500, model year 2007-2009 Dodge 3500, model year 2009 Mighty Mover, model year 2006-2009 Ford E-250, E-350 and E-450, model year 2008-2009 GMC W4500, model year 2007 International 4300, model year 2009 Toyota Land Cruiser vehicles equipped with Carrier AIRV ceiling units, model nos. 68RV0010BA, 68RV0012CA, and 68RV0010EA. The heater element in these assemblies may be defective which could cause the unit to create smoke or sparks. This defect could result in a fire. E-N-G Mobile System will notify owners and the vehicles will be repaired by Carrier free of charge. Please see Carrier's defect report 09E-053. The safety recall is expected to begin during December 2009. Owners may contact Carrier at 1-877-584-7059 or E-N-G Mobile System at 1-925-798-4060.

09V-434

Mitsubishi is recalling model year 2008-2009 Lancer and Lancer Evolution vehicles originally sold in or currently registered in the states of Connecticut, Delaware, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, Wisconsin and District Of Columbia. In areas where heavy road salt is used in the winter, a long term exposure to a mixture of melted snow with salt thrown up by the other vehicles on the road may cause a water-salt mixture to adhere to the front impact sensors. This coating over time may cause corrosion or the sensor. In the event of a vehicle crash of the type that would deploy the airbags this type of short-circuit may cause a delay in the deployment of the airbags which could result in driver or passenger injury. Dealers will install new front airbag sensors that have improved corrosion resistance. This service will be performed free of charge. The safety recall began on November 27, 2009. Owners may contact Mitsubishi Customer Relations Department at 1-888-648-7820.

09V-435

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2009

Published December 3, 2009

Chrysler is recalling certain model year 2007 through 2008 Jeep Wrangler vehicles manufacture from June 2006 through July 2008, equipped with automatic transmissions. These vehicles were not equipped with a transmission fluid temperature warning system. Fluid could boil over and may come into contact with a hot engine or exhaust component and cause a fire. Dealers will inspect and install a "HOTOIL" message in the instrument cluster and a chime indicating an elevated transmission fluid condition. The recall is expected to begin during December 2009. Owners may contact Chrysler at 1-800-835-1403.

09V-436

Roadtrek is recalling certain model year 2007-2009 class B Roadtrek RSAD, SSAD, RSAF and SSAF motorhomes built on Chrysler Sprinter van chassis. The brake line comes in close proximity to the battery and battery tray and can rub against them. This situation can damage the coating on the brake line and expose the bare steel. Also, battery acid can drip on the brake line. Either of these defects could result in a brake fluid leak which could cause partial brake failure. This could result in a crash. Dealers will inspect the brake line for adequate clearance between the line and the battery and battery tray. When required they will move the brake line if not compromised. If compromised they will replace the line and install it with adequate clearance. The remedy will be performed free of charge. The safety recall began on November 30, 2009. Owners may contact Roadtrek at 1-888-762-3872.

09V-437

Chrysler is recalling certain model year 2007 Dodge Nitro passenger vehicles. The windshield wiper system may experience a condition over time where high usage of the variable pause wiper function ("delay" mode) may eventually affect primary wiper function, rendering the wiper system inoperable. Inoperative wipers under inclement weather conditions could cause impaired visibility increasing the risk of a crash. Dealers will inspect and add external relays and update the totally integrated power module software to control the wiper functions. The safety recall is expected to begin during December 2009. Owners may contact Chrysler at 1-800-835-1403. Chrysler's campaign number is J28.

09V-438

Country Coach is recalling certain model year 2007 and 2008 motorhomes manufactured between April 2006 and March 2008, equipped with Caterpillar C15 engines. The variable valve actuation (VVA) oil line may wear against the p-clips retaining the oil line, causing an oil leak. An oil leak could result in a fire. Country Coach is working with caterpillar to repair the engines. The free repair will be performed by Caterpillar. Please see Caterpillar's safety recall campaign 09E-020. The safety recall began on October 23, 2009. Owners may contact Caterpillar at 1-800-447-4986 or Country Coach at 1-541-998-3720.

09V-439

Farber is recalling certain model year commercial specialty vehicles manufactured between March 4 and October 20, 2009, equipped with Carrier AirV ceiling units, Model Nos. 68RV0010BA, 68RV0012CA, AND 68RV0010EA. The heater element in these assemblies may be defective which could cause the unit to create smoke or sparks. This defect could result in a fire. Farber will notify owners and the vehicles will be repaired free of charge. The repairs will be performed by Carrier. The safety recall began on November 17, 2009. Owners may contact Carrier at 1-877-584-7059 or Farber at 1-800-331-3188.

09V-440

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2009

Published December 3, 2009

Blue Bird is recalling certain model year 2010 Vision school buses manufactured between May 12 and September 10, 2009 that were equipped with an optional wheelchair lift. The wheelchair lift power cable may come in contact with the engine exhaust manifold. Should the cable contact the manifold, its insulation would melt causing a potential for a direct short which could result in a vehicle fire. Blue Bird will notify owners and dealers will inspect the wheelchair lift power cable and repair if necessary. The safety recall is expected to begin on or about December 12, 2009. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's recall campaign number is R09PW.

09V-441

Medtec Ambulance is recalling certain model year 2007-2009 AD-170, FD-160 and PD-168 ambulances equipped with carrier AIRV ceiling units, model nos. 68RV0010BA, 68RV0012CA, and 68RV0010EA. The heater element in these assemblies may be defective which could cause the unit to create smoke or sparks. This defect could result in a fire. Medtec Ambulance will notify owners and the ambulances will be repaired by carrier free of charge. Please see Carrier's defect report 09E-053. The safety recall is expected to begin on or before December 15, 2009. Owners may contact Carrier at 1-877-584-7059 or Medtec Ambulance at 574-534-1318. Medtec's campaign number is 35-1570451.

09V-442

Tiffin is recalling certain recreational vehicle equipped with Norcold model 1200LR and 1200IRIM refrigerators, manufactured from December 1, 2001, with serial numbers between 1273701 and 1536607, non-consecutively. A fatigue failure in the section of the cooling unit which contains the refrigerant could allow the liquid solution to slowly leak. If a leak occurs and the refrigerator continues to be operated after solution circulation has ceased the heat source could generate very high temperatures. At such high temperatures, the cooling unit could rupture. If a leak occurs and the unit is continues to operate, hydrogen gas may be expelled and can be ignited, resulting in a fire, possibly causing serious injury or death. Tiffin is working with Norcold and Tiffin will notify owners and the vehicle's refrigerator will be repaired free of charge by Norcold. Please see Norcold's defect report 09E-027. Owners may contact Norcold's Recall Center at 1-800-767-9101.

09V-443

Toyota is recalling model year 2000-2003 Tundra vehicles originally sold in or currently registered in the following states: Connecticut, Delaware, Illinois, Indiana, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, Wisconsin and the District of Columbia. Excessive corrosion of the rear cross member may cause the separation of the spare tire stowed under the truck bed which would present a road hazard that could cause a crash. Also, corrosion of the rear cross member could affect the rear brake lines and the proportioning valve resulting in diminished braking capability. Separation of the spare tire and diminished brake capacity could increase the risk of a crash. Toyota is asking owners of the affected vehicles to remove the spare tire from under the vehicle until a remedy can be obtained. Dealers will inspect the rear cross member and related components, including the brake lines, and replace them if necessary. If the cross member does not need to be replaced, it will be sprayed with a corrosion protection compound. These services will be performed free of charge, however multiple visits to the dealer may be required. The safety recall is expected to begin on or before December 15, 2009. Owner may contact Toyota at 1-800-331-4331.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2009

Published December 3, 2009

09V-444

Volvo is recalling model year 2010 XC60 vehicles. The driver's seat side cover panel (seat control panel) in certain driver's side impacts may release the attachment of the seatbelt to the seat frame. Should this condition occur in a crash the seatbelt may fail to properly restrain the occupant increasing the risk of injury. Dealers will modify the inside of the driver's seat side cover panel free of charge. The recall is expected to begin on or before December 15, 2009. Owners may contact Volvo at 1-800-458-1552.

09V-445

MCI is recalling certain model year 2005-2008 D4000, model year 2005-2009 D4500 and D4505 transit buses, equipped with Caterpillar C13 engine and 50DN alternator. The alternator cable may become loose within the cable clamp, which could result in chafing of the alternator cable and possible arcing of the cable wires. This could result in a fire. MCI will notify owners and replace the alternator cable clamp and related hardware free of charge. The safety recall began on November 20, 2009. Owners may contact MCI customer service at 1-800-241-2947.

09V-446

Ferrari is recalling certain model year 1995 through 1999 Ferrari 355 and 355 F1 vehicles. Independent automobile repair facilities may have improperly installed certain screw clamps that are located in close proximity to the fuel lines and that fasten the water sleeve to the thermostat connection. The improper installation of these screw clamps may damage the fuel supply pipes. Fluid could leak into the engine compartment, causing smoke and, in some circumstances, a fire, rendering the vehicle inoperable and possibly resulting in a crash. Dealers will install a new fuel divider block, which will serve to provide a greater distance between these screw clamps and the fuel lines. This will eliminate the possibility of any damage to the fuel supply pipes which could cause fluid leakage. This service will be performed free of charge. The recall is expected to begin during December 2009. Owners may contact Ferrari at 201-816-2600.

09V-447

Mitsubishi Fuso is recalling certain model year 2005 through 2010 FE83D, FE84D, FE85D and FG84D vehicles. The weather resistance properties of the air intake duct rubber cushions is insufficient. During normal vehicle operation, the rubber cushions deteriorate and crack, causing abnormal noise. All of the rubber cushions could crack, allowing the air intake duct to fall off of the truck increasing the risk of crash. Dealers will replace all of the air intake duct rubber cushions with components manufactured to proper specifications. This remedy will be performed free of charge. The safety recall is expected to begin on or before February 19, 2010. Owners may contact Mitsubishi Fuso at 1-856-467-4500.

09V-449

Certain model year 2006 through 2010 Blue Bird Micro Bird single rear wheel model school buses manufactured from August 31, 2005 through September 27, 2009, fail to conform to Federal Motor Vehicle Safety Standard No. 110, "Tire Selection And Rims." If the vehicle is not equipped with a spare tire, then the tire and loading placard should indicate "NONE" under the size and recommended tire inflation pressure. The placard listed inflation pressure for a spare tire that was the same as the front tire inflation pressure. Inflation pressure required for the rear tires could be higher than the front tire which

SAFETY DEFECT/NONCOMPLIANCE NOTICES RECEIVED DURING NOVEMBER 2009

Published December 3, 2009

could cause premature tire wear resulting in a potential tire failure, increasing the risk of a vehicle crash. Blue Bird will provide replacement tire and loading placards with the appropriate spare tire indicated to owners free of charge. The campaign is expected to begin on or about December 9, 2009. Owners may contact Blue Bird at 1-478-822-2242.

09V-450

Daimler Trucks is recalling certain model year 2008 and 2010 Freightliner M2, Custom Chassis, MT55 and Sterling Acterra vehicles manufactured between April 4, 2007 and July 15, 2009, equipped with Cummins ISC CM2150 and ISL CM2150 model diesel engines. The vehicles may be designed with a hard wired, dash-mounted switch that enables the vehicle operator to inhibit aftertreatment diesel particulate filter regeneration in environments where the operator believes it may be unsafe for elevated exhaust temperatures. Due to an issue with the logic in the ECM software in these engines, the switch may not function correctly, leading the operator to believe that the switch is in "inhibit" mode when it is not. This condition will permit hot exhaust gases to exit the vehicle tailpipe, increasing the risk of melting or burning of nearby surfaces, or a fire. Daimler Trucks is working with Cummins to repair the engines free of charge. Please see Cummins' defect report 09E-046. Owners may contact Cummins at 1-800-DIESELS (1-800-343-7357) or Daimler Trucks at 1-800-547-0712.

09V-451

Daimler Trucks is recalling certain model year 2007 through 2009 Sterling 360 vehicles. The weather resistance properties of the air intake duct rubber cushions is insufficient. During normal vehicle operation, the rubber cushions deteriorate and crack. All of the rubber cushions could crack, allowing the air intake duct to fall off of the truck increasing the risk of crash. Dealers will replace all of the air intake duct rubber cushions with components manufactured to proper specifications. This remedy will be performed free of charge. The safety recall is expected to begin on or before February 19, 2010. Owners may contact Daimler Trucks at 1-800-547-0712.

09V-452

Mercedes-Benz is recalling model year 2009 550 G-Class vehicles. The fuel line quick connectors located under the vehicle away from the engine compartment may not have been connected properly on the assembly line and completely seated in the connection. In case of a frontal crash, the fuel pump would no longer function but a partial dislocation of the line could lead to a potential for fuel loss from the line at the quick connector. Fuel leakage, in the presence of an ignition source, could result in a fire. Dealers will check the connection of the fuel line quick connectors and install a new clamp to assure the quick connectors secure connection. The remedy will be performed free of charge. The safety recall is expected to begin during January 2010. Owners may contact Mercedes-Benz at 1-800-367-6372.

09V-453

Chrysler is recalling certain Model Year 2010 Jeep Grand Cherokee passenger vehicles manufactured from October 22 through November 12, 2009. The passenger side airbag may not properly deploy through the instrument panel tear seam. The airbag may not properly protect the passenger in the event of a crash, increasing the risk of injury. Dealers will replace the top cover of the instrument panel free of charge. The campaign is expected to begin in December 2009. Owners may contact Chrysler at 1-800-853-1403. Chrysler's campaign number is J33.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING NOVEMBER 2009**

Published December 3, 2009

09V-454

Spartan is recalling 14 Model Year 2005 and 2006 motorhomes manufactured between November 12, 2004 and March 1, 2006, equipped with Caterpillar C15 engine. The variable valve actuation oil line may rub against the p-clips retaining the oil line, causing an oil leak. An oil leak may result in a fire hazard. Spartan is working with caterpillar to remedy these vehicles. Please see recall 09E-020. Caterpillar will inspect and repair the necessary components free of charge. The safety recall is expected to begin on or about December 11, 2009. Owners may contact Caterpillar toll-free at 1-800-447-4986 or Spartan at 1-800-543-4277 - Option 1. Spartan's campaign number is 09025.

09V-455

Cues, Inc. is recalling certain Model Year 2007-2009 service vehicles built on various chassis equipped with Carrier AirV ceiling units, Model Nos. 68RV0010BA, 68RV0012CA, and 68RV0010EA. The heater element in these assemblies may be defective which could cause the unit to create smoke or sparks. This defect could result in a fire. Cues is working with carrier to remedy the affected vehicles. Repairs will be made by Carrier free of charge. Please see Carrier's defect report 09E-053. The safety recall is expected to begin during December 2009. Owners may contact Carrier at 1-877-584-7059 or Cues at 1-407-849-0190.

09V-456